


Technical Bulletin SAMSUNG DCS 061	
Issued by: I Heyer Date: 24/04/03 Approved by : D Ridley Date: 24/04/03	Signed: Signed: 
Replaces Technical Bulletin : N/A	
Subject : DCS816 PSU	Number of pages: 1

There is the potential for the DCS816 power supply to fail shortly after installation on systems purchased in April 2003.

This has been caused by an incorrect value of capacitor being installed during the manufacturing process.

The problem component is the large brown electrolytic capacitor on the PSU (C6) which can be viewed through the outer grille. The correct component is marked 400wv 150uF, the wrong component is marked 200wv 470uF.

If the incorrect component is identified, please ring Returns Dept for a replacement system on 0161 655 1138 as soon as possible.